


NOTE:
This drawing is only relevant to the Ground floor ACM removal, fire compartmentation, associated branch reinstatement works and the compression works for the relocation of the staff welfare facilities from the second floor to the first floor with the inclusion of a tea point at ground floor level

For wind and weather tight works refer to Wates documante Ref: 50333700-250153-WTS-XX-XX-CSR-MC-001-01 Lids Worthing _ Scope for LBA

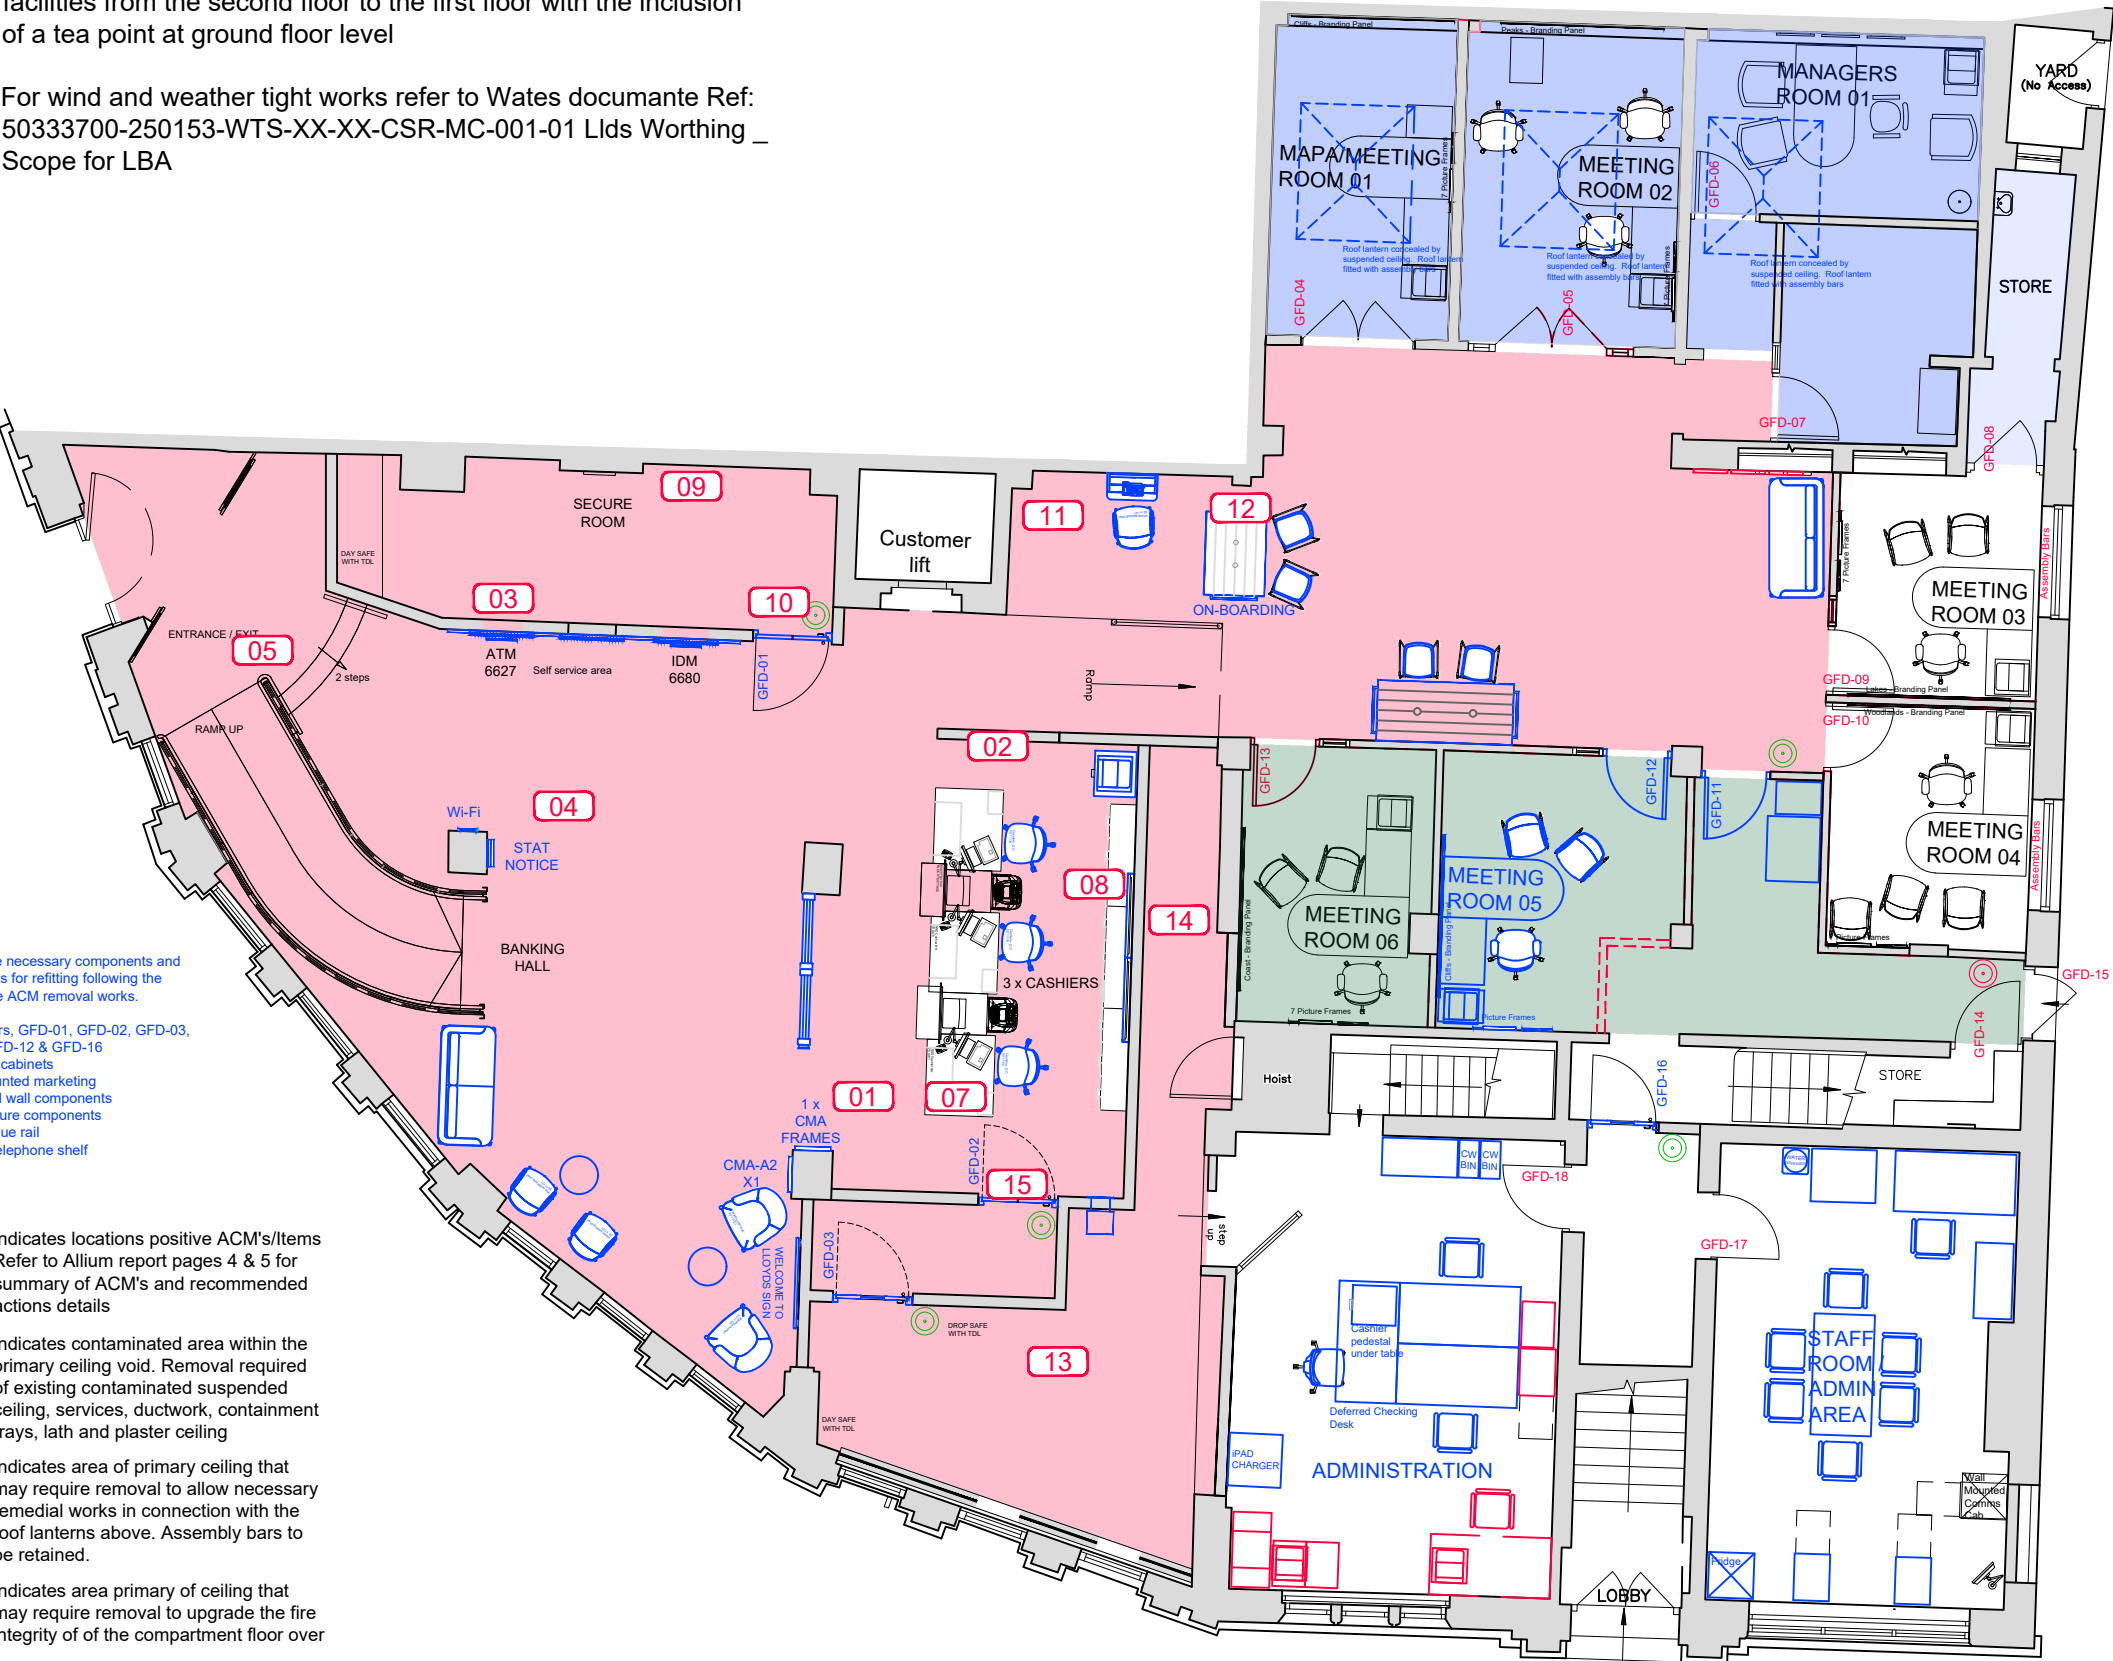

Carefully remove necessary components and store in readiness for refitting following the completion of the ACM removal works.

- Secure doors, GFD-01, GFD-02, GFD-03, GFD-11, GFD-12 & GFD-16
- Secure key cabinets
- All wall mounted marketing
- ATM slatted wall components
- Loose furniture components
- counter queue rail
- Customer telephone shelf

00 Indicates locations positive ACM's/items Refer to Allium report pages 4 & 5 for summary of ACM's and recommended actions details

Indicates contaminated area within the primary ceiling void. Removal required of existing contaminated suspended ceiling, services, ductwork, containment trays, lath and plaster ceiling

Indicates area of primary ceiling that may require removal to allow necessary remedial works in connection with the roof lanterns above. Assembly bars to be retained.

Indicates area primary of ceiling that may require removal to upgrade the fire integrity of of the compartment floor over

Item No.	Building Name	Room No & Name	Asbestos Containing Product	Recommended Action	Risk
2	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
1	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
5	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
4	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
3	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
7	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
8	LBGWorthing	001 Banking Hall	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
9	LBGWorthing	002 ATM Room 1	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
10	LBGWorthing	002 ATM Room 1	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
11	LBGWorthing	003 Lobby	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
12	LBGWorthing	003 Lobby	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
14	LBGWorthing	004 ATM Room 2	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
13	LBGWorthing	004 ATM Room 2	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium
15	LBGWorthing	005 Air Lock	Insulation Board Panel - Ceiling	Restrict Access & Remove	Medium

NOTE:
This drawing must be read in conjunction with the current Refurbishment Survey Report prepared by Allium Environmental Ltd which takes precedent over all other environmental information and any removal processes unless otherwise stated

OUTLINE SCOPE OF WORKS RELATING TO ASBESTOS REMOVAL

- Full asbestos removal methodology to be provided by Allium Environmental
- AMD to provide cause and effect schedule for MEP service
- Mitie F&S to provide cause and effect schedule for security systems
- Removal existing furniture components and obstructions to allow for positioning of mobile access equipment
- Removal of existing primary suspended ceiling and associated MEP
- Removal of existing lath and plaster secondary ceiling where first floor void has been compromised. Extent of removal to be confirmed
- Removal of ceiling void service, ducts and cabling due to historic contamination
- Removal of non load-bearing partitions to contaminated areas that require removal to form the proposed interim layout.

B	01/12/25	Stage 4 - Listed Building Submission	CM/ PW
A	10/11/2025	Initial CP Submission for costing	CM/ PW
REV	DATE	REVISION	INITIALS



LLOYDS BANKING GROUP

ALL DIMENSIONS TO BE VERIFIED PRIOR TO COMMENCING WORK. DRAWING TO BE READ IN CONJUNCTION WITH PROJECT SPECIFICATIONS.

THIS DRAWING IS THE PROPERTY OF LLOYDS BANKING GROUP AND COPYRIGHT IS RESERVED BY THEM. THE DRAWING IS ISSUED ON CONDITION THAT IT IS NOT COPIED OR DISCLOSED BY OR TO ANY UNAUTHORISED PERSONS WITHOUT PRIOR CONSENT IN WRITING TO LLOYDS BANKING GROUP - GROUP PROPERTY. ALL MODIFIED DRAWINGS SHOULD BE RETURNED TO LLOYDS BANKING GROUP.

GROUP PROPERTY

BRISTOL - PO Box 112, Canons House, Canons Way, BRISTOL, BS99 7LB
EDINBURGH - Signhill South, 12 Bankhead Crossway South, EDINBURGH, EH11 4EN
HALIFAX - Trinity Road, HALIFAX, West Yorkshire, HX1 2RG

PROJECT ADDRESS	SCALE
Brand - Lloyds	A1 - 1:50
Worthing 41-43 South Street	A3 - 1:100
41-43 South Steet	DATE
WORTHING BN11 3AU	07/04/2025
DRAWING DESCRIPTION	DRAWN BY
Ground Floor	-
Existing Plan Asbestos Annotation	REVISION
DRAWING NUMBER	B
50333700-HLN-XX-00-M2-AREX-0901	

STAGE 4 - CONTRACTORS PROPOSALS