


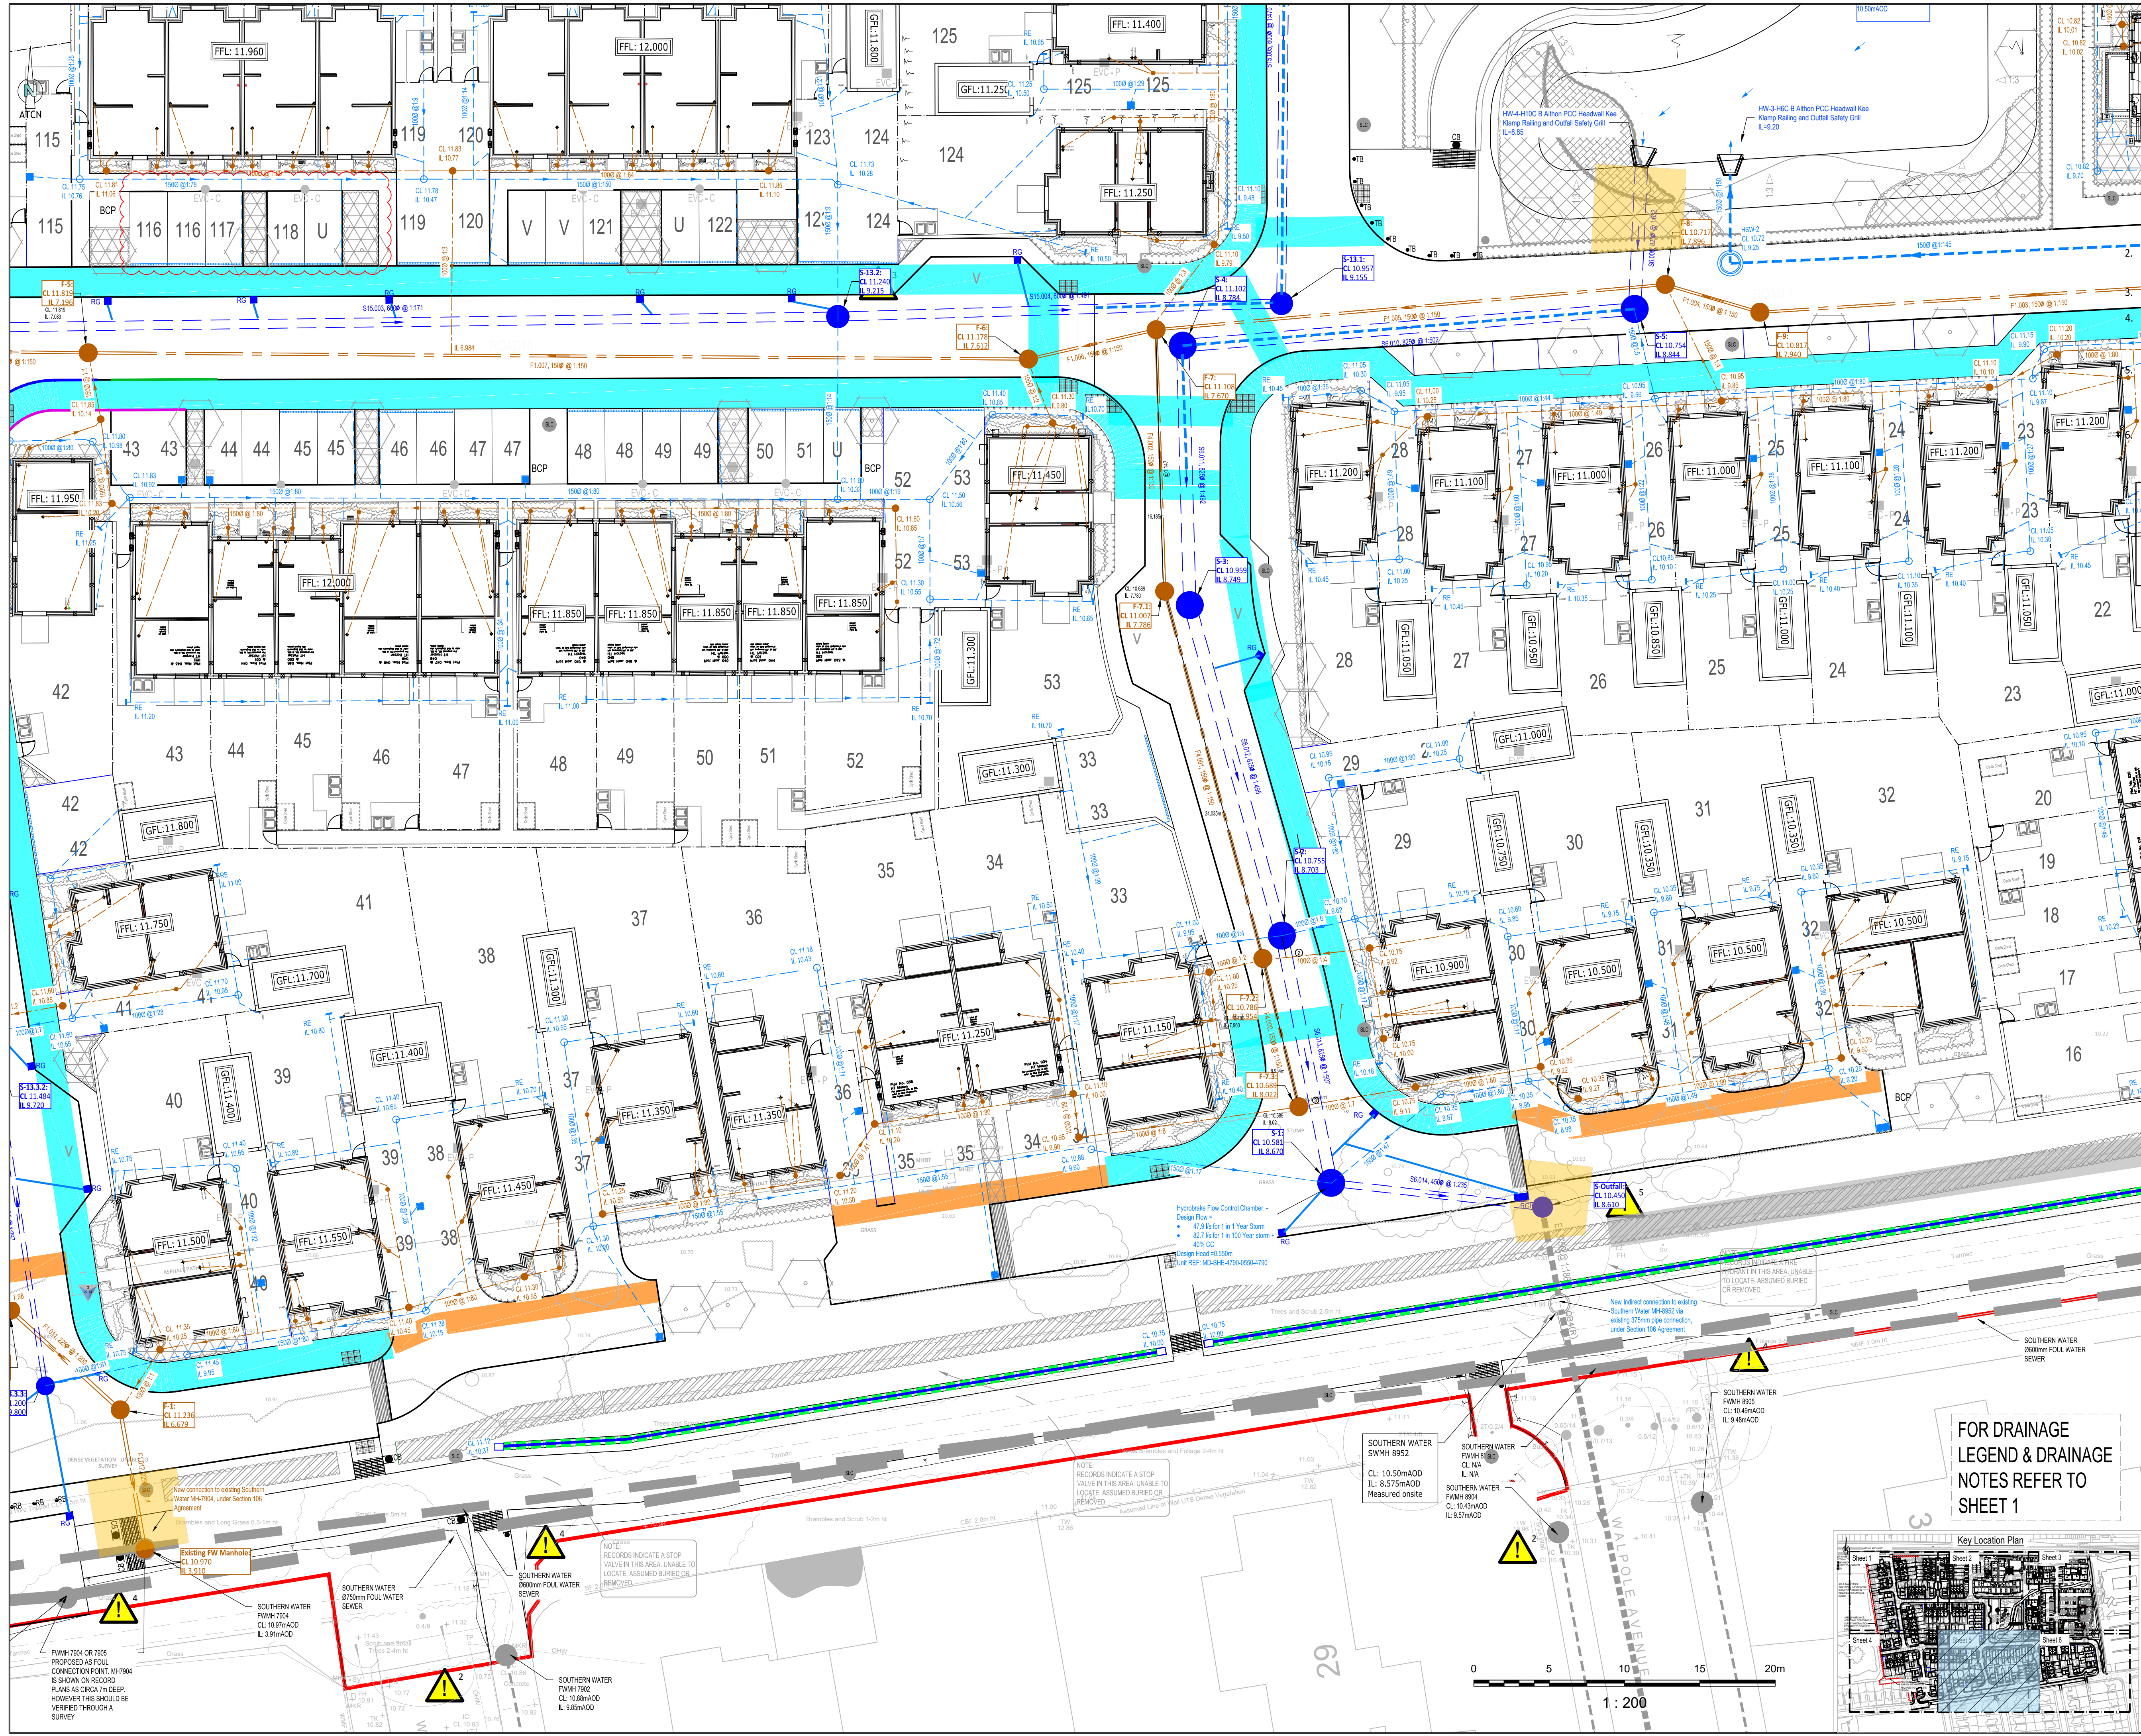

General Notes

Where this drawing has been issued in electronic .dwg format it has been done so in good faith. ATCN Consulting LTD do not take any responsibility for any inaccuracies in the electronic data, which should be checked against the paper (or .pdf) drawing issue. Any apparent discrepancies should be immediately reported to ATCN Consulting LTD. The electronic .dwg file should not be assumed to be to scale and should not be used for 'overlaid', setting out or checking of any third party information. All dimensions should be taken from the paper (or .pdf) version of the drawing. Electronic drawings may contain third party information. ATCN Consulting LTD take no responsibility for this information, which should be checked against the Originators paper drawing(s).

All dimensions to be checked on site prior to construction/fabrication.

Do not scale from this drawing.

Any discrepancies between drawings of different scales, and between drawings and specification where appropriate to be notified to ATCN Consulting LTD for decision.

Copyright reserved. This drawing may only be used for The Client and location specified in the title block. It may not be copied or disclosed to any third party without the prior written consent of ATCN Consulting LTD.

This drawing should only be used for construction if the drawing status is "Construction". ATCN Consulting LTD take no responsibility for construction works undertaken to drawings which are not marked with this status.

Health & Safety Note

The details on this drawing have been prepared on the assumption that a competent contractor will be carrying out the works. If the contractor(s) considers that there is insufficient Health and Safety information on this drawing, this should immediately be brought to the attention of the designer.

HAZARD IDENTIFICATION BOX			
This table is provided to assist the Principal Contractor to fulfil their obligations under the CDM Regulations 2015			
Hazard Ref	Hazard Type (Construction/Maintenance/ Clearing/Excavation/Adaptation)	Hazard Description	Mitigation Measures/Residual Risk
2	ALL	Working adjacent to live carriageway	Contractor to install necessary traffic management.
3	ALL	Working with deep excavation	Safety MS, fencing/signage, correct shoring & propping of excavation
4	ALL	Working near by sleep banking	Contractors Safety Method Statement. Fencing, guarding and signage.
5	ALL	Live utilities including GASELECOWATER	Contractors Safety Method Statement. Scan/ Locate and mark all services prior to commencing work. Hand dig to locate services
Site Wide	ALL	Potential ground gases and elevated arsenic	Contractor to provide relevant PPE to workers, and hotspots marked out onsite.

Rev	Date	Description	Rev / Chk / App
C11	15/04/24	Updated Levels / Drainage for Parking bays outside of Plots 116-119 as Clouded	MSK/MAT
C10	16/01/24	Drainage reviewed and updated for plot 116-123 as clouded	KAMS/AA
C9	21/12/23	Approved for Construction	MSK/AA
C8	09/10/23	Site wide plot drainage connections to S/WP/RWPa/CDVYG reviewed & amended.	MSK/AA
C7	19/09/23	Perforated pipe added between manhole S4-S5 as clouded	KAMS/AA
C6	01/09/23	Removal of swales, Filter drain & IC added as clouded.	KAMS/AA
C5	07/08/23	Update F/W mains drainage to prevent clashing, flat blocks F/W plot drainage update for clashes with ground beams, additional RGS as clouded.	MSK/AA

Rev. Date Description Rev / Chk / App

A1 - Approved/Stage Complete

Client Logo: **Bellway**

ATCN CONSULTING
Surbiton | Slough
Web: www.atcnconsulting.com
Tel: 01753 708949

Client: **Bellway Homes Limited**



Job: **Barrington Road, Durrington**

Title: **Drainage Design Plan Sheet 5 of 6**

Classification: **FI 60 20**
Scale @ A1: **1:200**

Project: **K43058-ATCN-92-ZZ-DR-C-2105** Revision: **C11**

Project: Originator: Volume/System: Level/Location: Type: Designer: Number: Revision: K43058

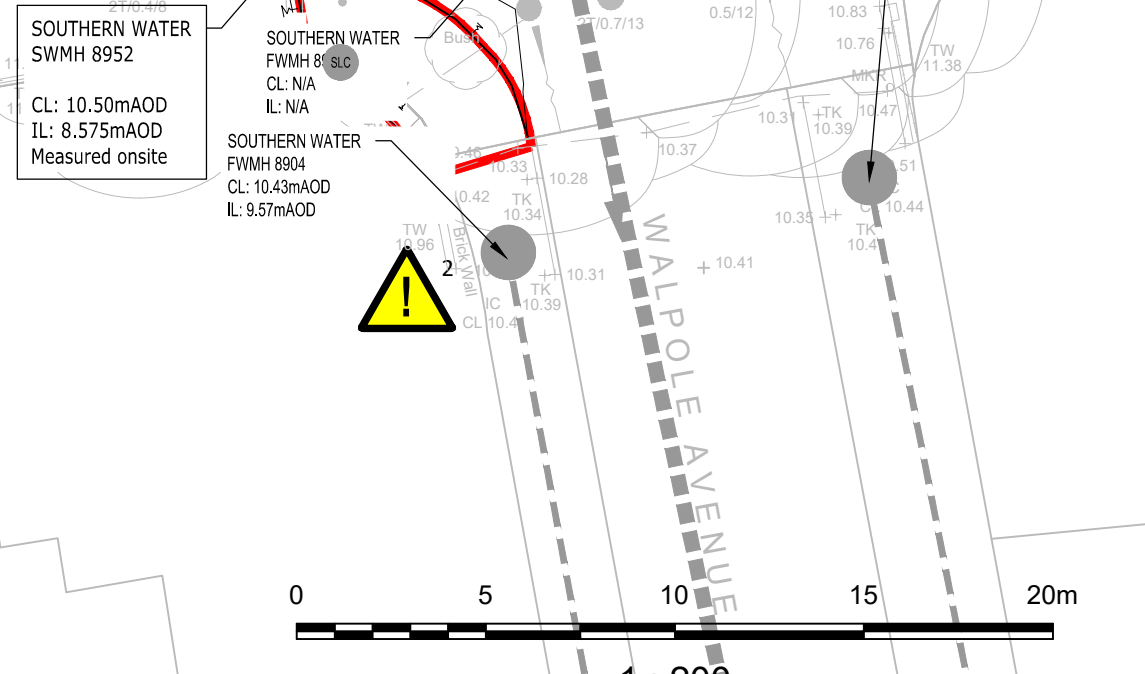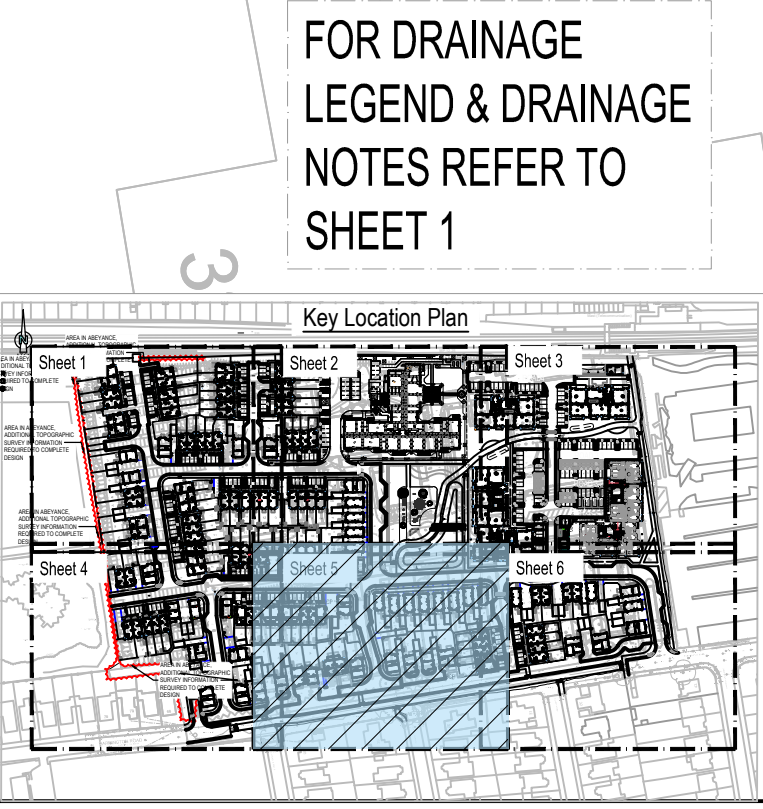

NOTE: RECORDS INDICATE A STOP VALVE IN THIS AREA, UNABLE TO LOCATE, ASSUMED BURIED OR REMOVED.

NOTE: RECORDS INDICATE A STOP VALVE IN THIS AREA, UNABLE TO LOCATE, ASSUMED BURIED OR REMOVED.

NOTE: RECORDS INDICATE A STOP VALVE IN THIS AREA, UNABLE TO LOCATE, ASSUMED BURIED OR REMOVED.

NOTE: RECORDS INDICATE A STOP VALVE IN THIS AREA, UNABLE TO LOCATE, ASSUMED BURIED OR REMOVED.

NOTE: RECORDS INDICATE A STOP VALVE IN THIS AREA, UNABLE TO LOCATE, ASSUMED BURIED OR REMOVED.